






Display & buttons

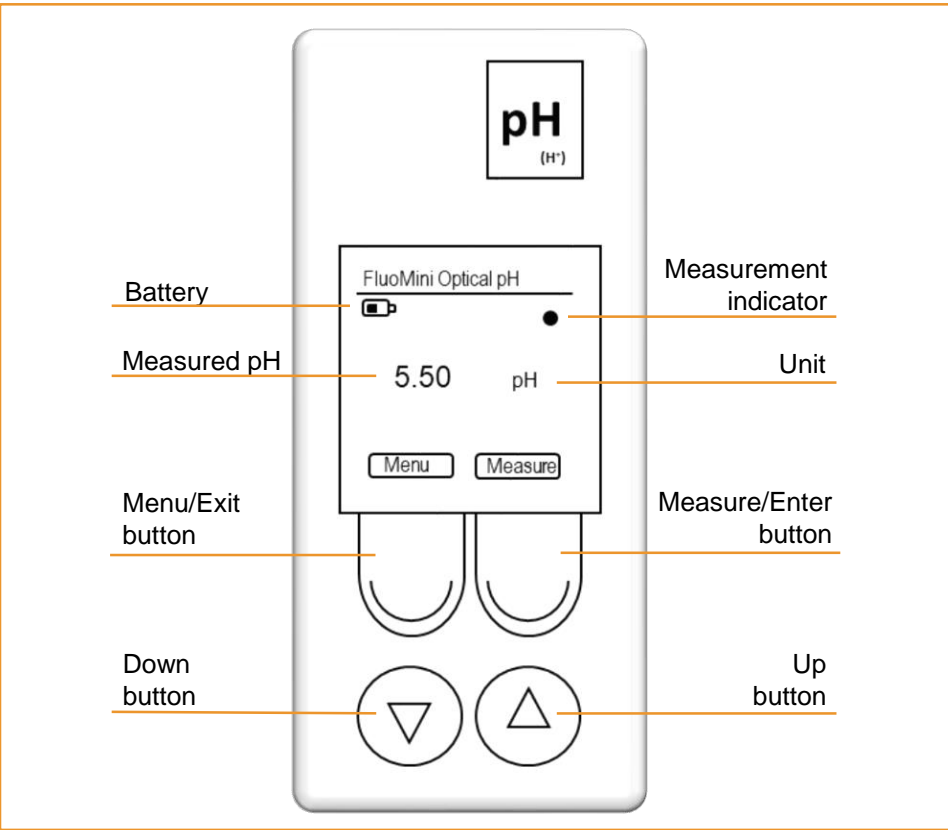

Menu/Exit button	Enter & exit main menu
Measure/Enter button	End sleep mode Single measurement > press briefly Start/stop continuous measurement > press 2 sec

Calibration




Use buffer pH 4 & 7

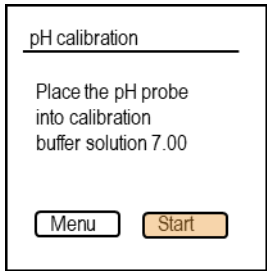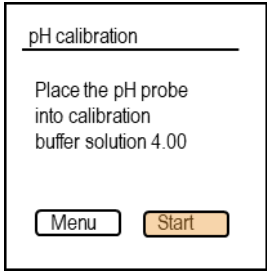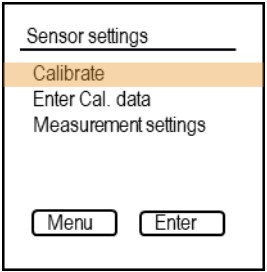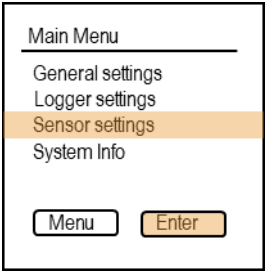




Remark: Sensor is calibrated before delivery. Calibrate after fiber has been removed.

Log function

Set interval time

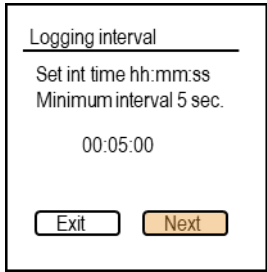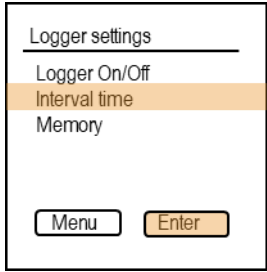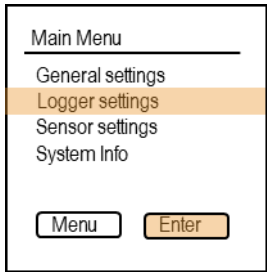

Start logging

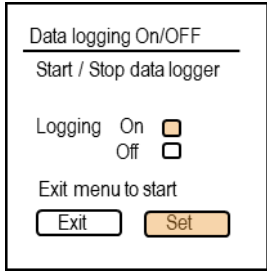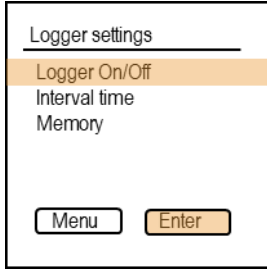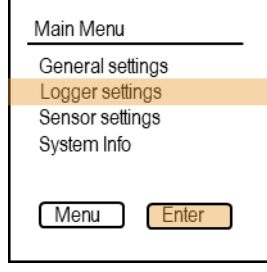

CAUTION!
Direct contact between the pH sensitive coating and the medium to be measured is important for an adequate measurement. Please, use the included pre-drill & probe support for measurements in substrate to protect the coating from any damage. For further information read the manuals.